




# Forix™ IP 2X 2 P+E German socket

## Cat. No.(s): 7 824 11/13/18/20/23/41/43/48/50/53

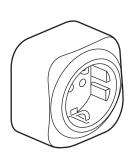

7 824 11/20/41/50

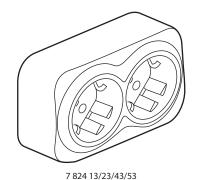

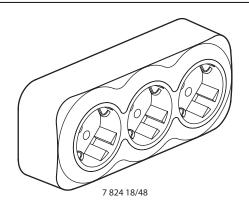


## 1. USE


General 16 A german socket outlet. Horizontal or vertical mounting for sockets multiple.

## 2. RANGE

Finishes		Designation	
White	lvory	Designation	
7 824 11	7 824 41	2 P+E socket without shutters	
7 824 13	7 824 43	2 x 2 P+E socket without shutters	
7 824 20	7 824 50	2 P+E socket with shutters	
7 824 23	7 824 53	2 x 2 P+E socket with shutters	
7 824 18	7 824 48	3 x 2 P+E socket with shutters	

## 3. OVERALL DIMENSIONS (mm)

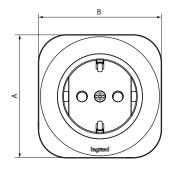





Cat. No.	Α	В	С
7 824 11/20/41/50	65	65	38.5
7 824 13/23/43/53	65	110	38.5
7 824 18/48	65	155	38.5

## 3. OVERALL DIMENSIONS (continued)

## ■ 3.1 Single base

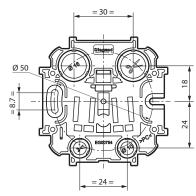


## ■ 3.2 Double base

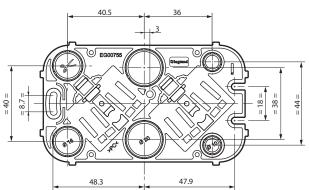


## 3. OVERALL DIMENSIONS (continued)

#### ■ 3.3 Triple base

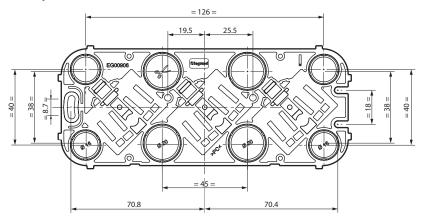

## 4. CONNECTION

## Information for pre-cut:

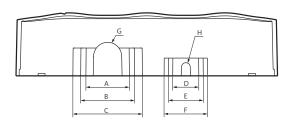

Cat. No.	Pre-cut sides (mm)				
	A 25 x16	B 31 x 16	C 40 x 16	D 15 x 10	
7 824 11/20 7 824 41/50	2	-	-	2	
	E 20 x 10	F 25 x 10	G Ø 16	H Ø 5	
	2	-	2	2	
	A 25 x16	B 31 x 16	C 40 x 16	D 15 x 10	
7 824 13/23	-	2	2	1	
7 824 43/53	E 20 x 10	F 25 x 10	G Ø 16	H Ø 5	
	2	-	2	2	
	A 25 x16	B 31 x 16	C 40 x 16	D 15 x 10	
7.024.10/40	-	4	4	1	
7 824 18/48	E 20 x 10	F 25 x 10	G Ø 16	H Ø 5	
	2	-	2	4	

Stripping: 11 mm
Terminal type: with screws
Terminal capacity up to: 2 x 2.5 mm<sup>2</sup>
Recommended screwdriver size: pozidrive No 2
Recommended tightening torque: 0.8 Nm

#### **5. TECHNICAL CHARACTERISTICS**

## ■ 5.1 Mechanical characteristics

Protection against liquids:

- For Cat. Nos 7 824 11/13/41/43: IP 20

- For Cat. Nos 7 824 18/20/23/48/50/53: IP 21

Impact tests: IK 04

## ■ 5.2 Material characteristics

Cover: PP

Cover for Cat. No 7 824 18/48: PC

Mechanism: PC

## ■ 5.3 Electrical characteristics

Voltage: 250 VAC Current: 16 A

## ■ 5.4 Climatic characteristics

Storage and use temperature: -  $25^{\circ}$  C to +  $60^{\circ}$  C

# 6. CLEANING

Surface cleaning with a cloth.

Do not use: acetone, tar remover, trichloroethylene.

Resistance to the following agents: Hexane (EN 60669-1), Methylated spirits, Soapy water, Diluted ammonia, Diluted pure bleached 10%, Glass cleaning substance, Pre-impregnated wipes.

**Caution:** A preliminary test should be carried out if other specific cleaning products are to be used.